




4. Limit Switch Assembly & Mounting

This guides goes over assembling and mounting the limit switches for your WorkBee CNC Machine.


Written By: Robert

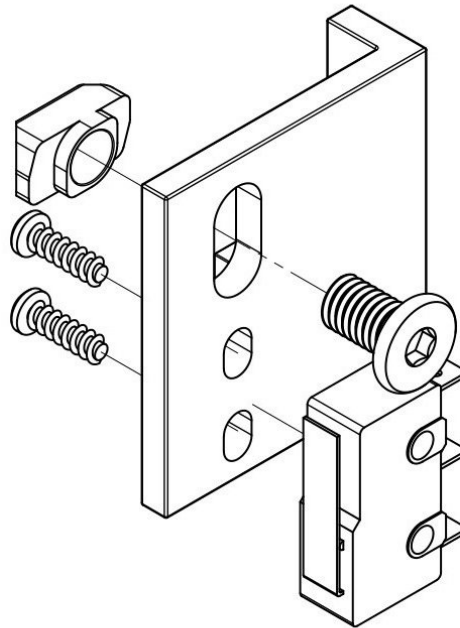

INTRODUCTION


Be very careful to not over tighten the nuts and bolts on the plastic parts, otherwise they may crack. Everything should easily fit together, and so if it isn't, take a step back and re-read the instructions.

Step 1 — Checking Limit Switch Version

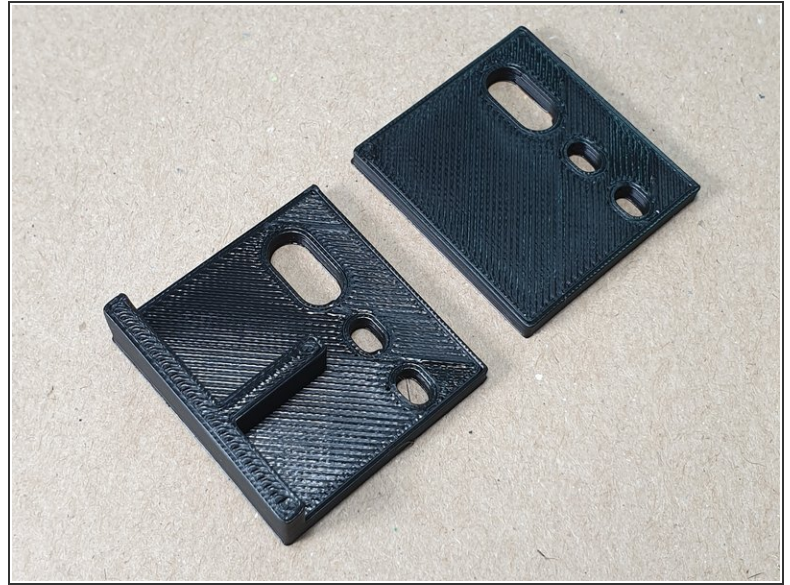


- ⚠ Depending on when you brought your WorkBee CNC Machine they may of been shipped with different limit switches and bracket versions. Please follow the appropriate guide.
- If you have the Aluminium Brackets Version in picture 1 follow this link - [Aluminium Limit Switch Guide](#)
 - ☑ Also follow the above guide for wire routing your machine. Skip guide 4 which follows this one.
 - If you have the 3D Printed Brackets in picture 2 move on to Step 2 of this guide.

Step 2 — Assembling & Attaching the X Axis Limit Switch

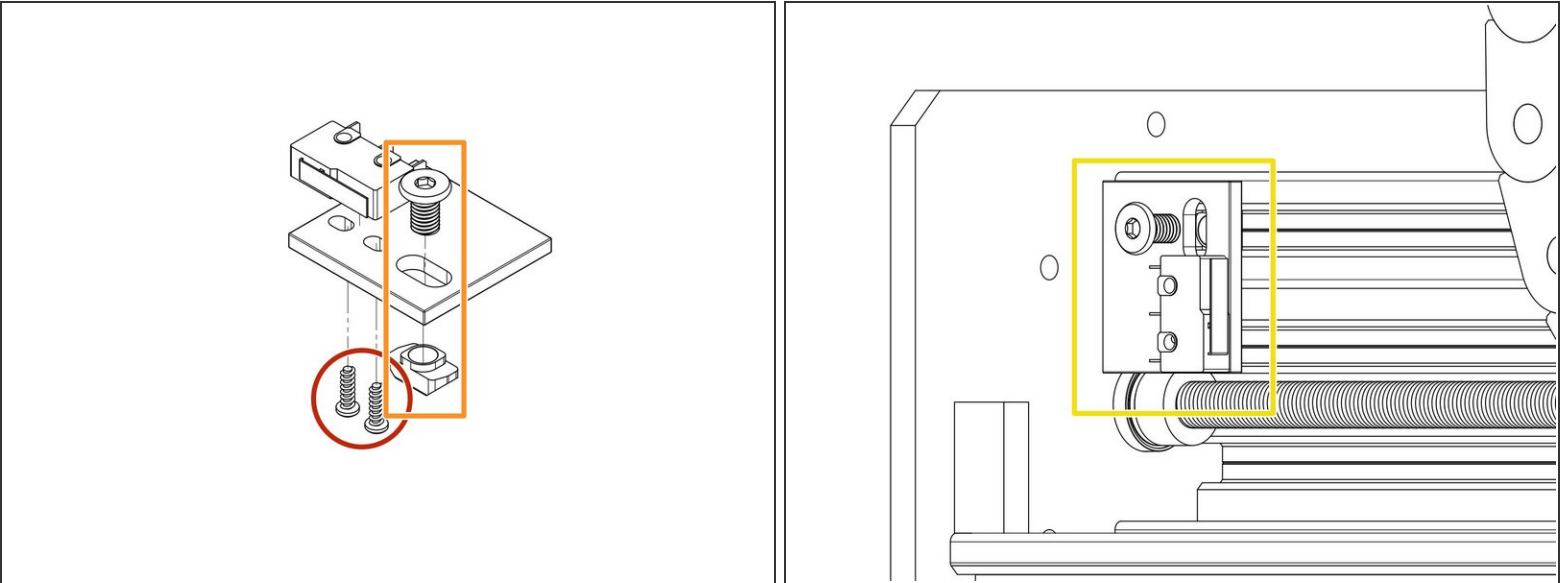


- Carefully attach the X-Axis Limit Switch to the X-Axis Limit Switch Mount using 2 x M3 Plastite Screw - 8mm's. The M3 Plastite Screw - 8mm's self thread, the best technique is to screw in a couple of turns, then back out, and then back in a few more turns than last time, and so forth, until the Limit-Switch is firmly secured.
 - ⚠ Do not over tighten as you can shatter the switch. Make sure the Limit-Switch is orientated as the X-Axis-Limit-Switch-Assembly picture.
- Attach a M5 Low Profile Bolt - 8mm through the elongated hole and slightly thread on a M5 Drop In Tee Nut.
- Attach the X-Axis Limit Switch Mount assembly to the back side of the X-Axis C-Beam. It should be oriented as the second picture, on the far left hand side (If looking from the back of the machine). The X-Axis Limit Switch Mount should be touching the Y-Plate.
- ⓘ Tighten the M5 Low Profile Bolt - 8mm bolt, engaging the M5 Drop In Tee Nut with the top slot of the X-Axis C-Beam.

Step 3 — Assembling & Attaching the Y Axis Limit Switch

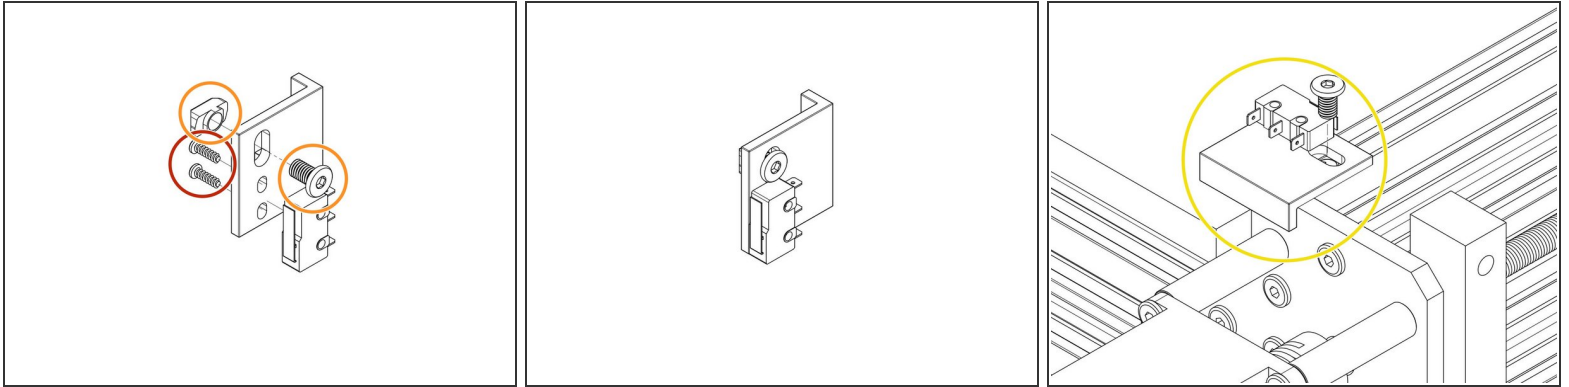


- Carefully attach the Y-Axis Limit Switch to the Y-Axis Limit Switch Mount using 2 x M3 Plastite Screw - 8mm's. The M3 Plastite Screw - 8mm's self thread, the best technique is to screw in a couple of turns, then back out, and then back in a few more turns than last time, and so forth, until the Limit-Switch is firmly secured.
 - ⚠ Do not over tighten as you can shatter the switch. Make sure the Limit-Switch is orientated as the Y-Axis-Limit-Switch-Assembly picture.
- Attach a M5 Low Profile Bolt - 8mm through the elongated hole and slightly thread on a M5 Drop In Tee Nut.
- Attach the Y-Axis Limit Switch Mount assembly to the back side of the Right Y-Axis C-Beam (If looking from the back of the machine). It should be oriented as the third picture. The Y-Axis Limit Switch Mount should be touching the Y-C Beam Extrusion.
- ⓘ Tighten the M5 Low Profile Bolt - 8mm bolt, engaging the M5 Drop In Tee Nut with the top slot of the Y-Axis C-Beam.

Step 4 — Finished Assembly Review

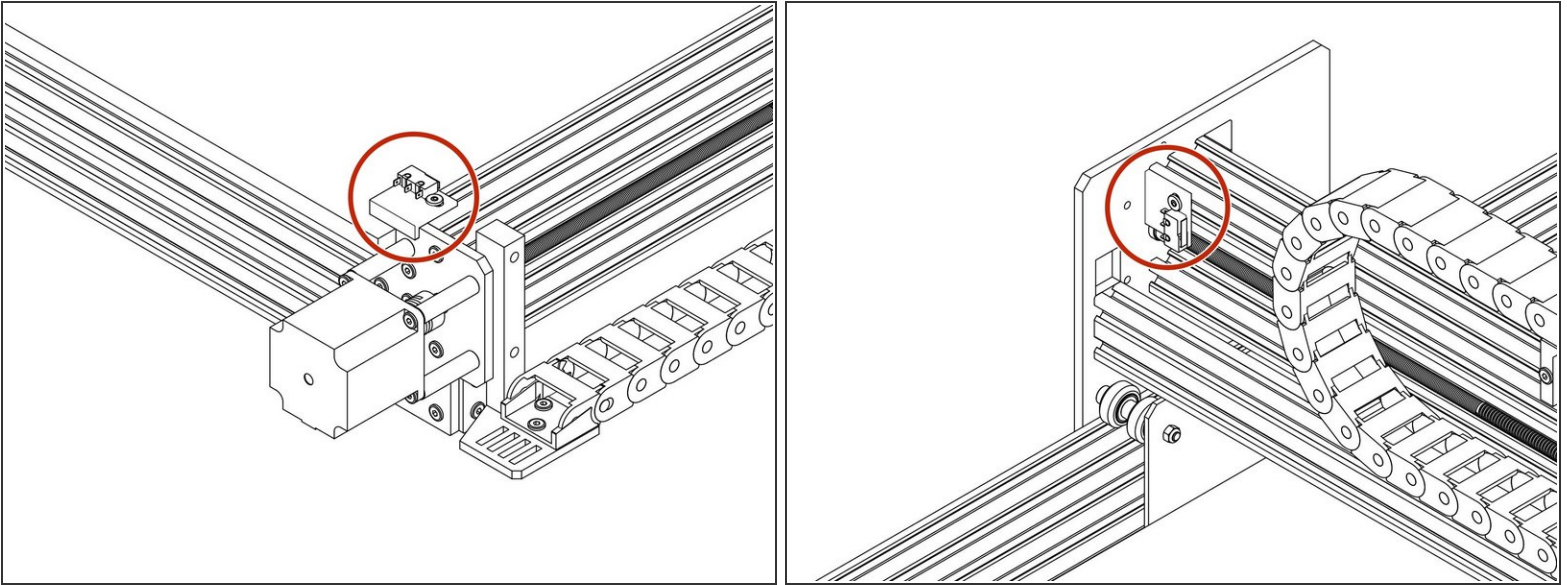

- ❗ At this stage of the guide review your machine and guide pictures to ensure correct installation.
- Your finished assemblies should look like the pictures once completed.

Step 5 — Z Limit Switch Mounting

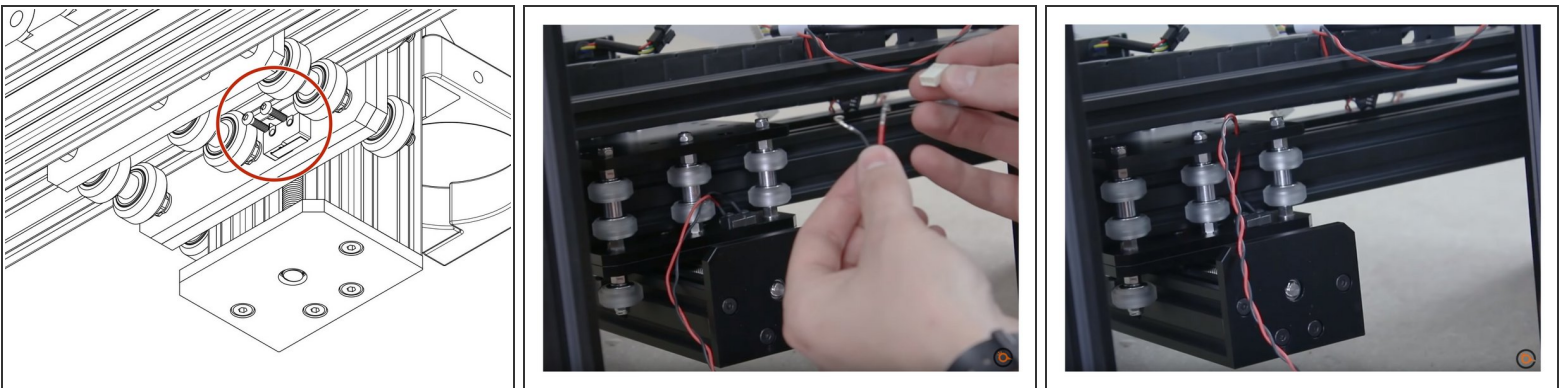

- Attach the Z-Axis limit switch to the threaded holes on the X-Plate-Front using 2 x M3- Socket-Head-10mm bolts, in the same orientation as the picture.
- ⚠ Do not over tighten as you can shatter the switch. Make sure the Limit-Switch is orientated as the Z-Axis-Limit-Switch-Assembly picture.

Thanks for following the guide. Any issues, please contact us!